SERVICE INFO



Risk of confusion between tensioning pulleys 531 0252 30 and 531 0525 30

Vehicle

manufacturers: Seat, Škoda, VW

Models:

Škoda:

Seat: Arosa, Cordoba, Ibiza II,

Ibiza III, Ibiza IV, Inca

Felicia I, Felicia II, Octavia

VW: Bora, Caddy II, Fox,

Golf III, Lupo, Polo,

Vento

Engines: 1.0, 1.0i, 1.3, 1.4, 1.4i,

1.6, 1.6i, 1.9 TDI

Part Nos.: 531 0252 30

531 0525 30



Image: Distinguishing between tensioning pulleys 531 0252 30 (left) and 531 0525 30 (right)

There is a risk that tensioning pulleys 531 0252 30 and 531 0525 30 could be confused with one another.

Not only are the item numbers very similar, there is very little to differentiate the devices from a visual perspective.

Before installing the tensioning pulleys, it must be ensured that the part number is correct. The similarity of the numbers means there is an increased risk of confusing these two components.

Any reference to replacement part numbers for vehicle manufacturers is for comparison purposes only.

Only the pointers of the two tensioning pulleys and the alignment of the pointers (see image) is different.

However, from a technical perspective, the two devices are very different. Tensioning pulley 531 0252 30 has a higher tensioning force and a larger operating range than tensioning pulley 531 0525 30.

Interchanging the tensioning pulleys could lead to oscillation, thereby causing the toothed belt to skip. It could even result in damage to the engine.



Note the specifications of the vehicle manufacturer!

Appropriate spare parts can be found in our on-line catalogue at www.Schaeffler-Aftermarket.com or in RepXpert at www.RepXpert.com.

Issued 03.2011

INA 0069

Subject to technical changes
© 2011 Schaeffler Automotive Aftermarket

For further information:

Phone: +44 (0) 14 32 264 264* Fax: +44 (0) 14 32 375 760

Info@LuK-AS.co.uk

www.Schaeffler-Aftermarket.com
* Calls from within the UK 08457 001100

