

# Technical *Info*

Timing belt kit CT 881 K3, for example Ford 1.25 16V / 1.4 16V / 1.6 16V

**Problem:**

Crankshaft screws of different lengths (29 and 44.5 mm) are supplied in the kit.

**Cause:**

A 44.5 mm long screw has been used with effect from production date 15.08.2005.

**Solution:**

To make doubly sure that the appropriate screw is used, you must determine the depth of the bore.

42 mm: 29 mm screw

52 mm: 44.5 mm screw

Both screws are tightened to a torque of 40 Nm + 90°.

**Fig. 1**  
**29 mm version**



**Fig. 2**  
**44.5 mm version**

