Product Information XZI106


Part number identification on the steering column - Renault Modus (J77)

The following has to be taken into account when replacing the steering column on the Renault Modus (J77): the design of the entire steering column unit has changed due to a change in the model series.


As the new versions are backward compatible, they can be installed in older vehicle models with minor modifications. If the old design was installed in the vehicle and you want to install the new design, you have to additionally replace the cardan shaft between steering gearbox and steering column.

To identify the correct part, please note the tables shown on the second page.

If the label shown in the following is attached to the steering column, this provides the relevant numbers for identifying the correct replacement part.

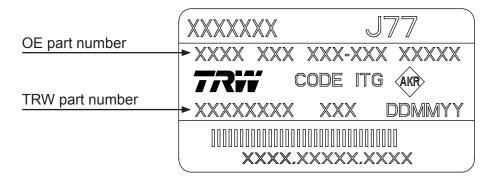

Another way to distinguish between the old and the two newer designs is the motor housing.

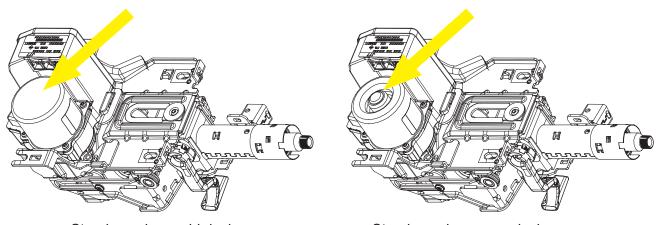

Steering column old design

Steering column new design





Product Information XZI106



For vehicles with left hand drive

| Engine | Year of manufacture | Label | | TRW | Decign | OE part number |
|-------------------------------|-------------------------|----------|------------|--------|--------|----------------|
| | | TRW no. | OE no. | number | Design | Cardan shaft |
| 1.2 16V | > 20/07/2005 | 50300785 | 8200433516 | JCR167 | old | |
| | 21/07/2005 - 31/01/2007 | 50300683 | 8200307151 | JCR170 | new | 8200751229 |
| | 01/02/2007 > | A0013424 | 8200751216 | JCR139 | | |
| | | A0015991 | 8200826816 | | | |
| 1.4 16V 1.6 16V 1.5 dCi | > 20/07/2005 | 50300783 | 8200433517 | JCR166 | old | |
| | 21/07/2005 - 31/01/2007 | 50300689 | 8200307154 | JCR169 | new | 8200751229 |
| | 01/02/2007 > | A0013430 | 8200751219 | JCR129 | | |
| | | A0015995 | 8200826817 | | | |



For vehicles with right hand drive

| Engine | Year of manufacture | Label | | TRW | Doolan | OE part number |
|-------------------------------|-------------------------|----------|------------|---------|--------|----------------|
| | | TRW no. | OE no. | number | Design | Cardan shaft |
| 1.2 16V | > 20/07/2005 | 50300786 | 8200433519 | JCR7167 | old | |
| | 21/07/2005 - 31/01/2007 | 50300684 | 8200307160 | JCR7170 | new | 8200751231 |
| | 01/02/2007 > | A0013425 | 8200751222 | JCR7139 | | |
| | | A0015993 | 8200826818 | | | |
| 1.4 16V 1.6 16V 1.5 dCi | > 20/07/2005 | 50300784 | 8200433520 | JCR7166 | old | |
| | 21/07/2005 - 31/01/2007 | 50300690 | 8200307161 | JCR7169 | new | 8200751231 |
| | 01/02/2007 > | A0013431 | 8200751223 | JCR7129 | | |
| | | A0015997 | 8200826819 | | | |